



CHEVROLET MOTOR DIVISION  
General Motors Corporation  
Chevrolet Service Department



# Chevrolet Dealer Service Technical Bulletin

68-T-22

Number:

I

Section:

Jan. 30, 1968

Date:

Subject: RESTRICTED AIR FLOW - ASTRO-VENTILATION  
SYSTEM - 1968 CAMARO SPORT COUPES

Attn: Service Manager

To: ALL CHEVROLET DEALERS

Some early built 1968 Camaro Sport Coupes with a stationary rear seat back may have inadequate Astro-ventilation air flow due to the lack of "cut outs" in the rear compartment front foundation.

When complaints of poor air circulation are encountered, check the front foundation of the rear compartment (See Sketch) to assure the "cut outs" are removed. If they are still present, perform the following operation to correct.

1. Reaching through the open rear compartment, mark the foundation (with a felt tip pen or suitable marker) to outline pattern as shown by broken line in attached illustration.

NOTE: It may be necessary to remove spare tire.

2. Remove rear seat back.
3. Remove rear compartment front foundation from the seat back support hooks (3) and lay on a suitable flat surface for cutting operation.
4. With knife (or similar tool) cut along pattern to conform with shaded areas shown in illustration.
5. Replace foundation, seat back and cushion.

## PARTS AND LABOR DATA


QUA.	PART NO.	PART DESCRIPTION	P	FC	L	T	OPERATION NO.	TIME
1				25	X		01770090	.5

Chevrolet Motor Division  
General Motors Corporation

c: Dealer List  
Chevrolet List

Important That All Service Personnel Read—Please Initial

Service Manager		Shop Foreman		Service Salesman			Service Technicians							

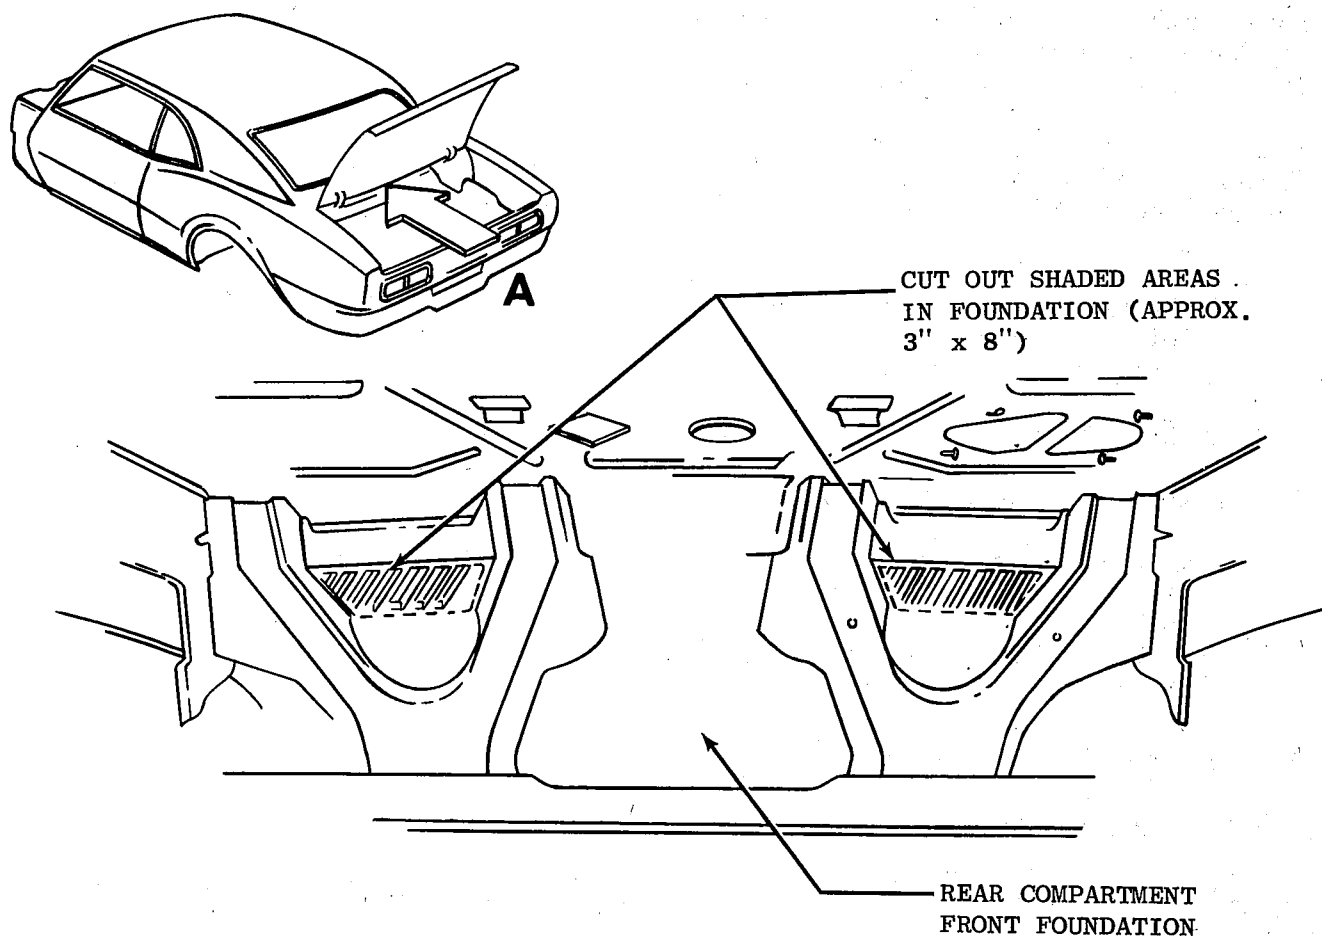

VIEW IN DIRECTION OF ARROW **A**